

Page 1 of 5 04/06/21

Hour Meter: Meter at Install Vendor: Year Bought: Alt. Vendor: Manufacturer: Serial #: Item: Model #: 2004 Sexsmith Industrial Repair Multicam canada West Inc Multicam canada West Inc. 5-307-R-03817 5307-R (PARTS AND MANUAL) Router Multicam 5000 Series Approx Cost: Total Hours: Hours at Install 0 \$107,900 BLOW OUT OIL FILTER CHECK FILTER VISUAL INSPECTION Work Required GL CODE 51000-1400 Detailed Description: **₩** 1767 1867 10/27/2020 12/11/2020 WO Date WO Type 3 Months 3 Months 6 Months Frequency PM Completed 03/09/202 04/01/2021 Next Date Hourly Freq. Comp. Date 01/14/2021 10/30/2020

1409

03/14/2019

PN PM PM PM

1426 1458 1517 1520

04/17/2019

10/06/2019 10/16/2019

1356

10/01/2019

10/01/2019

10/01/2019

10/01/2019 04/17/2019 04/17/2019 10/06/2019 10/16/2019 10/16/2019 12/11/2019

1556

11/12/2019

10/16/2019

PM PM 1649 1677 1729 1732

12/03/2020

PM PM PM PM

05/19/2020

02/06/2020 10/13/2020 10/13/2020

02/06/2020

10/13/2020 10/13/2020



04/06/21 Page 2 of 5

Tighten Spindle gear to the gear rack 1Operator report crack on the hand held control- Y axis has play phone S exsmith to adjust
Order Vacuum Filters at Airplus Systems 604-882-3741 \$84 00 ea
01/11/2016
01/11/2016
01/11/2016
01/11/2016
08/11/2016
08/11/2016
09/11/2016
09/11/2016
09/11/2016
04/19/2018
06/26/2018
11/09/2018



04/06/21 Page 3 of 5

Chip extractor's hose need to be hang away from electrical connection.		RLVT	03/03/2016
	\$165.50	BC Fasteners	04/12/2016
Noise coming from top worm gear motor and or bearing, operators need to be vigilat. RL/DL.		ST	04/14/2016
Hand Held Control stop working, Duane Lans was the operator at the time.			08/25/2016
Hand control is working, we belive that was drop and disconected inside.		Reidco	08/29/2016
Vaccum pump bearing/take vaccum apart, broked housing and lock nut n eed to be replace. Asking for price.		zeidco/vexsmith	11/00/2010
Motor bearing replaced, Vaccum housing weld in house by Regan and put back by GH/VT	<u>a</u> .	ISPM/ Sexsmith/Reid	11/18/2016
Replace YX motor.		Sexsmith	10/06/2017
No cooling air pressure but machine worked 3 hrs in the afternoon with B.F. Will check today.		Reidco	10/13/2017
.00 Change hand held control cable, problem continues. Called Tech Help line but did not solve the problem, booking a service call.	\$160.00	Sexsmith Industrial	11/15/2017
1:30 PM air pressure alarm, fixed. 2:00 no comunication to host error, Krist ian and Leigh was advise of the problem			11/22/2017
7:00am no news from Kristian or Leigh, machine is not running.			11/23/2017
Found broken wires in harness.12/04/17 wires replaced by Sexsmith Ind.			11/27/2017
Multicam was here and will come back with all parts need it for service, bear ing, gears etc. Unit is running well.		Mullicarii	12/00/2017
		Multicam	02/16/2018
	\$3,400.00	Multicam	03/27/2018
Mister system reported cracked.		Reidco	03/27/2018
Change vaccum filter/Grease railing and berarings.		R. Lockhart	08/01/2018
Spindle stop working, bearing shut.			08/21/2018
Switch spindle and send for repair the other \$7000,00 the cost.		Multicam	09/18/2018
Reported a computer proble.		Duane	01/28/2019
Solved problem.?		Kristian	01/29/2019
Sent motors for rebuid: two MGC motors and one BNC3500-F to Potomac Ele ctric Corp.			10/10/2019
Replace Z axis motor		Sexsmith Industrial	10/10/2019
Loose spindle - drive belt skipping, fixed		RLVT	10/17/2019
.25 Replace Z axis motor.	\$299.25	Sexsmith	11/19/2019
.99 Muffler air vaccu mm.	\$359.99	Fastenall	12/09/2019



04/06/21 Page 4 of 5

\$3,501.02 \$6,300.00 \$1,796.80 \$10,132.50 \$4,979.84		\$340.00	Sexsmith Industrial	02/11/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, a Higher number of router bits broken or darn managment.  Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools.  \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information.  \$6,300.00 purchase 3 servo motors YXZ two need it to router)  6:00am Rob reported to Steve and Leigh th inform of the problem at 11:00, we lost 5 hc Invoice #8174 Problem holding its Surface. We received instruction as how to fix the pr time.there is no time ( Steve/Rob)) The Router continue to have problems, the manualy done and it works.  BREAK ELECTRIC W/ HUB FOR Z AXIS Multicam is here and we run a full sheet wit the problem, too heavy, operator failed to re The machine is now running ok. Is not keeping surface, can't find the proble Multicam suggested to have a different hos \$10,132.50 Spare Spindle Repair. We have one spare \$4,979.84 Refurbish See invoice #8084 - PO# 4492: Russ O'shea tech. Machine refurbish by Mu	order Y X motor ahead to prevent long time down, they are hard to find.  Computer back working		Kristian	02/12/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, a Higher number of router bits broken or darn managment.  Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools.  \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information.  \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh th inform of the problem at 11:00, we lost 5 hc Invoice #8174 Problem holding its Surface. We received instruction as how to fix the pr time.there is no time ( Steve/Rob)) The Router continue to have problems, the manualy done and it works.  BREAK ELECTRIC W/ HUB FOR Z AXIS Multicam is here and we run a full sheet wit the problem, too heavy, operator failed to re The machine is now running ok. Is not keeping surface, can't find the proble Multicam suggested to have a different hos \$10,132.50 Spare Spindle Repair. We have one spare \$4,979.84 Refurbish See invoice #8084 - PO# 4492:	Russ O'shea tech. Machine refurbish by Multicam. Recomentation: Clean m achine		Multicam	04/21/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, o Higher number of router bits broken or darn managment.  Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools.  \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information. \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh th inform of the problem at 11:00, we lost 5 hc inform of the problem holding its Surface. We received instruction as how to fix the pr time.there is no time ( Steve/Rob)) The Router continue to have problems, the manually done and it works.  \$544.32 BREAK ELECTRIC W/ HUB FOR Z AXIS Multicam is here and we run a full sheet wit the problem, too heavy, operator failed to re The machine is now running ok. Is not keeping surface, can't find the proble Multicam suggested to have a different hos \$10,132.50 Spare Spindle Repair. We have one spare	Refurbish See invoice #8084 - PO# 4492:	\$4,979.8	Multicam	04/28/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, of the collector and filters need to be clean, of the collector and filters need to be clean, of the collector and filters need to be clean, of the collector and filters need to be clean, of the collector and filters need to be clean, of the collector and filters need to be clean, of the collector and the control was dated to collector and the collector are not trained tools.  \$3,501.02 Invoice #165 Replace X and Y motors, made sending incorrect information.  \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh the inform of the problem at 11:00, we lost 5 ho invoice #8174 Problem holding its Surface.  We received instruction as how to fix the prime. The Router continue to have problems, the manually done and it works.  \$544.32 BREAK ELECTRIC W/ HUB FOR Z AXIS Multicam is here and we run a full sheet with the problem, too heavy, operator failed to run the machine is now running ok.  Is not keeping surface, can't find the problem Multicam suggested to have a different hos	Spare Spindle Repair. We have one spare	\$10,132.5	Multicam	05/04/2015
\$3,501.02 \$6,300.00 \$1,796.80 \$544.32	Multicam suggested to have a different hosing chip collector that the prese nt system		Multicam	06/15/2015
\$3,501.02 \$6,300.00 \$1,796.80	Is not keeping surface, can't find the problem		Reidco	06/16/2015
\$3,501.02 \$6,300.00 \$1,796.80 \$544.32	the problem, too heavy, operator failed to report the problem with the spe cifics of will The machine is now running ok.		Alamoni	
no note left, laser head crushed the same r Chip collector and filters need to be clean, a Higher number of router bits broken or darn managment. Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mate OrderCollets and Collets holder, these tool working properly, operators are not trained tools. \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information. \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh th inform of the problem at 11:00, we lost 5 hd Invoice #8174 Problem holding its Surface. We received instruction as how to fix the pr time.there is no time ( Steve/Rob)) The Router continue to have problems, the manually done and it works.		1100	Multicarii	06/18/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, or Higher number of router bits broken or dame managment.  Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mate OrderCollets and Collets holder, these tool working properly, operators are not trained tools.  \$3,501.02 Invoice #165 Replace X and Y motors, made sending incorrect information.  \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh the inform of the problem at 11:00, we lost 5 hours.  \$1,796.80 Invoice #8174 Problem holding its Surface.  We received instruction as how to fix the problems. The Router continue to have problems, the	manualy done and it works.	7	M	06/18/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, o Higher number of router bits broken or dam managment. Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mate OrderCollets and Collets holder, these tool working properly, operators are not trained tools. \$3,501.02 Invoice #165 Replace X and Y motors, made sending incorrect information. \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh th inform of the problem at 11:00, we lost 5 ho linvoice #8174 Problem holding its Surface. We received instruction as how to fix the pro- time there is no time ( Steve/Roch)	ms, the		Reidco	06/23/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, o Higher number of router bits broken or darn managment.  Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools.  \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information. \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh th inform of the problem at 11:00, we lost 5 ho Invoice #8174 Problem holding its Surface.	We received instruction as how to fix the problem but we are late and steve ha s to fix the problem but we are late and steve ha s to fix the problem.		Multicam	06/23/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, o Higher number of router bits broken or dam managment. Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools. \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information. \$6,300.00 purchase 3 servo motors YXZ two need it to router) 6:00am Rob reported to Steve and Leigh th inform of the problem at 11:00, we lost 5 ho		\$1,796.8	Multicam	06/24/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, o Higher number of router bits broken or darn managment. Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools. \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information. \$6,300.00 purchase 3 servo motors YXZ two need it to router)	6:00am Rob reported to Steve and Leigh that the machine wasn't not loading p rogra inform of the problem at 11:00, we lost 5 hours, Kristian is looking after the problem.		Reidco	08/10/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, o Higher number of router bits broken or dam managment. Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools. \$3,501.02 Invoice #165 Replace X and Y motors, mad sending incorrect information.		\$6,300.0	Multicam	06/25/2015
no note left, laser head crushed the same r Chip collector and filters need to be clean, o Higher number of router bits broken or dam managment. Reported that the hand held control was da Duane left a note that the router is having p issua was that he was not securing the mat OrderCollets and Collets holder, these tool working properly, operators are not trained tools.		\$3,501.0	Multicam	08/25/2015
Lans	working properly, operators are not trained tools.			
idco idco ane Lans	OrderCollets and Collets holder, these tool are in very poor condition and the m achie		Reidco	09/14/2015
idco	Duane left a note that the router is having problem cutting, we came to the c onclution issue was that he was not securing the material to the table property.		Duane Lans	10/06/2015
	Reported that the hand held control was damage presumable with a fork lift.		꼰	12/10/2015
	Higher number of router bits broken or damage this month. No explenation f rom ope managment.		Relaco	12/11/2015
	Chip collector and filters need to be clean, chips flying to machine shop station		Relaco	01/11/2016
	no note left, laser head crushed the same night.		<u>.</u>	
Duane Lans  Router hit went throug the wood of the table hit not tighten high risk of dame give to	Rollter hit went throllo the wood of the table hit not tighton high rick of dame give the		Duane Lans	03/02/2016

